

PB99-137622

# In-Service Performance Of HP Concrete Bridge Decks

FRANK T. OWENS SREENIVAS ALAMPALLI

REPRODUCED BY:
U.S. Department of Commerce
National Technical Information Service
Springfield, Virginia 22161



SPECIAL REPORT 130
TRANSPORTATION RESEARCH AND DEVELOPMENT BUREAU
NEW YORK STATE DEPARTMENT OF TRANSPORTATION
George E. Pataki, Governor/Joseph H. Boardman, Commissioner

•					
					•
					•
				•	
					•
					•


# IN-SERVICE PERFORMANCE OF HP CONCRETE BRIDGE DECKS

Frank T. Owens, Civil Engineer I Sreenivas Alampalli, Engineering Research Specialist II

Special Report 130 February 1999

PROTECTED UNDER INTERNATIONAL COPYRIGHT ALL RIGHTS RESERVED.
NATIONAL TECHNICAL INFORMATION SERVICE U.S. DEPARTMENT OF COMMERCE

TRANSPORTATION RESEARCH AND DEVELOPMENT BUREAU New York State Department of Transportation State Campus, Albany, New York 12232-0869



#### **ABSTRACT**

Current Department specifications require Class HP (for "high-performance") concrete for bridge decks in New York State. In April 1996, Class HP replaced Classes E and H concretes as the statewide standard to increase deck durability by reducing cracking and permeability, but subsequently some cracking of HP decks was reported. Initially, no quantitative details were yet available, so that actual HP deck performance could not be evaluated. At the request of the Structures Design and Construction Division, Technical Services Division, Bridge Performance Committee, and Concrete Committee, the Transportation R&D Bureau initiated a survey of the NYSDOT Regions to record their experience with this mix and quantify the resulting information. By June 1998, more than 80 bridge decks had been built specifying HP concrete. These structures were visually inspected by regional engineers after opening to traffic, indicating that 1) HP decks performed better than Class E and H decks in resisting both longitudinal and transverse cracking, 2) of 84 decks inspected, 49 percent exhibited no cracking at all, but of those that had cracked 88 percent showed equal or less longitudinal cracking and 80 percent equal or less transverse cracking than the previously specified concretes, and 3) average transverse crack density on HP decks was 6.9 cm/m<sup>2</sup>, a figure comparable to densities for other decks (not using HP mix) reported in the recent literature.

				•			
					•		
				•			
	•						
							•
					*		
	•					*	
•							
							÷
,							
							•
					e e		ų
	•						
		•					
			:				

# **CONTENTS**

- I. INTRODUCTION, 1
  Background, 1
  Study Approach, 2
- II. STATEWIDE SURVEY RESULTS, 3
- III. CONCLUSION AND RECOMMENDATIONS, 9

**ACKNOWLEDGMENTS**, 11

REFERENCES, 13

### **APPENDICES**

- A. Survey Questionnaire, 17
- B. Survey Response Results from NYSDOT Regions, 19
- C. Survey Comments from NYSDOT Regions, 25

	•						
			•				•
				•			
•							
				•			
							•
							-
		•					
	4 - 2						
							. '
					and the second s		

#### I. INTRODUCTION

#### **BACKGROUND**

The New York State Department of Transportation develops specifications for portland-cement concrete mixtures used for all state projects (1). Several mix "classes" are available depending on application, and those required for various structural-concrete items are indicated on contract plans. Until 1996, NYSDOT Class E concrete was the standard used for structural slabs and structural-approach slabs. Class H concrete was an allowable substitution in pumping applications. Mix criteria are given in Table 1.

A very evident problem on bridge decks built with Classes E and H concretes had been spalling due to rebar corrosion, directly attributable to excessive permeability by such concrete-deteriorating solubles as de-icing salts. To improve concrete durability, a Bridge Deck Task Force (comprised of materials engineers, researchers, and structural engineers) was formed in the Fall of 1994. They determined that significant improvement would result from a concrete mixture that reduced permeability and potential for cracking (2).

The Task Force reviewed the state-of-the-art, conducted laboratory testing and statistical analysis of several mixes, and formulated a new concrete mixture by modifying Class H concrete. Designated "high-performance" or "Class HP" concrete, this mix has two pozzolanic substitutions for cement (Table 1). It has better handling and workability characteristics, lower permeability, and greater resistance to cracking. Note that increased strength was not the primary concern. Based on an analytical model (3), it was estimated that corrosion might be expected to commence at 23 and 62 years of age for Class H and Class HP concretes, respectively. This model assumes 3 in. of concrete cover and use of uncoated reinforcing steel. Effective April 12, 1996, through Engineering Instruction EI 96-024 (4), Class HP concrete was implemented as the standard for all New York State bridge decks. By June 1998, more than 80 decks had been constructed using HP concrete.

Table 1. Mix criteria for Class E, H, and HP concretes.

Property	Class E	Class H	Class HP
Cement Density, kg/m³	384	400	300
Sand, % of Total Aggregate*	35.8	40.0	40.0
Water/Cement Ratio (weight)	0.44	0.44	0.40
Air Content, %	6.5	6.5	6.5
Fly Ash Content, kg/m <sup>3</sup>			80
Microsilica Content, kg/m³			25
Slump Range, mm	75-100	75-100	75-100
Coarse Aggregate Gradation	CA2	CA2	CA2

<sup>\*</sup>Solid volume.

After implementation of HP concrete, several reports were received regarding deck cracking, but evaluation of actual performance of HP concrete decks was impossible because no quantitative information was yet available. The Transportation R&D Bureau thus initiated a study to collect such data, at the request of the Structures Design and Construction Division, Technical Services Division, Bridge Performance Committee, and Concrete Committee. Results of that study are summarized here.

#### STUDY APPROACH

In consultation with the Concrete Engineering Unit of the Structures Division and members of the Bridge Performance Committee, it was decided to survey decks statewide where Class HP concrete had been used. A list of those completed from 1996 through early 1998 was produced using the Unit's own database and Materials Bureau staff records. A survey questionnaire was drafted and reviewed by the Structures Division, Bridge Performance Committee, and Region 1 Construction Engineer (Appendix A). It was modified based on comments received, and then sent to each region along with a list of that region's HP bridge decks. Regional Construction Engineers were asked to complete the forms after visually inspecting each HP concrete bridge deck. They were to focus on cracking that appeared to be unrelated to imposed loads. Information was requested on number, length, and plan location of all transverse cracks. Inspectors were also asked to compare performance of Class HP decks with those built using Class E and H concretes. The survey was also intended to determine time of crack initiation as well as the effects (if any) of staged construction on deck cracking.

Survey responses received from the NYSDOT regions are discussed in Chapter II, summarized in Appendices B and C, and were analyzed to determine frequency and severity of transverse cracking. Crack frequency was also analyzed by region and compared with data available from bridge decks built using Class E and H concrete. Final conclusions and recommendations are presented in Chapter III.

#### II. STATEWIDE SURVEY RESULTS

Responses received by the end of September 1998 are summarized in Appendix B. Information on general use of the mix, construction problems encountered, ease in finishing decks using this mix, and effects of staged construction, as received from Regional Engineers, is summarized in Appendix C. Tables 2 and 3 summarize survey results by region and year of construction, respectively. Figure 1 shows occurrence of deck cracking in relation to years-in-service. The front two bars represent transverse and longitudinal cracking on decks built in each of four years. Table 4 summarizes longitudinal and transverse cracking reported by regions, and Table 5 covers transverse crack density reported by the regions. Crack densities were estimated by dividing measured crack lengths by deck area, as obtained from the NYSDOT bridge inventory database. Table 6 summarizes transverse crack

Figure 1. Occurrence of cracking in relation to year built.

#### A. PERCENT OF DECKS

# 80% 80% 90 60% 1995 1996 1997 1998 Longitudinal

Table 2. Cracking by NYSDOT region.

	Total			Decks
NYSDOT	Decks	<u>Decks</u>	Cracked	Uncracked,
Region*	Inspected	Total	%	.%
1	14	11	78	22
2	12	11	92	8
3	. 1	0	0	100
4	5	0	0	100
. 5	15	8	53	47
7	7	4	57	43
8	7	3	43	57
9	10	3	30	70
10	13	3	23	77
Total	84	43	51	49

<sup>\*</sup>Regions 6 and 11 did not respond.

B. NUMBER OF DECKS

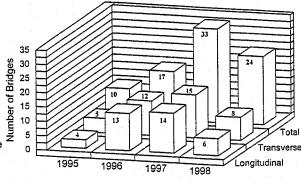


Table 3. Cracking by year built.

Year	Total Decks	Decks Transv Crack	/erse	Decks Longi Crack	tudinal
Built	Inspected	Total	%	Total	%
1995	10	5	50	4	40
1996	17	12	70	13	76
1997	33	15	45	14	42
1998	24*	8	33	6	25
Total	84	40	48	37	44
* D:14	through liv	100	5		

<sup>\*</sup>Built through June 1998.

widths. Table 7 gives results of comparisons between Class HP and Class E and H decks, including number, width, and length of transverse and longitudinal cracks. Table 8 and Figure 2 give estimates of time that cracking began. Based on this information provided by the regions, six general observations can be made:

- 1. Field inspections were completed on 84 bridge decks built with the Class HP concrete adopted in EI 96-024. Table 2 shows that 41 (49 percent) of the inspected decks exhibited no cracking at all, but 43 decks (51 percent) showed some form of cracking.
- 2. Table 3 and Figure 1 show the relationship between years-in-service and transverse and longitudinal deck cracking. Transverse cracking was found on 40 (48 percent) of the inspected bridges and longitudinal cracking on 37 (44 percent). Thirty-four (40 percent) bridge decks exhibited both transverse and longitudinal cracking. All decks listed were built using Class HP concrete. Although it would be expected that years-in-service might have significant negative effect on deck condition within this study's time-frame, it appears to have no influence on deck cracking.

In Figure 1B the first two rows of bars allow comparisons of successive annual numbers of decks showing longitudinal and transverse cracking. The back row represents total bridges inspected. Although use of Class HP began in 1996, several experiemental decks had been built earlier, and were included in the inspection lists provided to the regions. No obvious correlation appears between years-in-service and cracking or cracking density, based on these data. Average cracking densities per year (in cm/m²) are 9.0, 6.7, 4.2 and 5.0 for 1998, 1997, 1996 and 1995, respectively.

In 1995, ten test decks were built under supervision of the Materials Bureau. By 1996, HP concrete was in wide use. The 1996 peak in percentage of decks that exhibited cracking (Figure 1B), probably reflects that manufacturers, engineers-in-charge, and construction tradesmen were all at the beginning of their "learning curves" for this material. By 1997, quality of the decks, measured here by lack of cracking, increased as these participants became more familiar with the material. Numbers for 1998 seem to illustrate a leveling of the amount of cracking observed.

- 3. To minimize disruption to traffic flow, staged construction is often used in New York State. The survey looked for effects, if any, of this construction method on deck cracking and for information on whether decks had been built using staged or continuous construction, as well as comments concerning possible consequences for deck cracking. Table 4 shows results of this portion of the survey and specific comments are given in Appendix C. Staged construction appears to have had no negative effects -- such decks actually cracked less than those built continuously.
- 4. Transverse crack density was estimated for each bridge, as listed by region in Table 5. Average density of transverse cracks on HP decks was 6.9 cm/m², with a maximum density of 26.8 cm/m². Table 5 displays transverse-crack information only. Cracking densities collected in this study were compared with those published in the recent literature. Research Report 161 (5) described a study of long-term serviceability of full-scale, lightly reinforced bridge deck slabs

Table 4. Cracking by NYSDOT Region and type of construction.

	Total Deck	s Cracked			0/ -£ Deelse C	d	
	Staged		Continuous		% of Decks C	Continuous	
	Construction		Constructi		Staged		
Region*	Inspected	Cracked	Inspected	Cracked	Construction	Construction	
A. TRAI	NSVERSE CI	RACKING					
1	11	5	3	3	46	100	
2	8	7	4	4	88	100	
3	0	0	1	0	0	0	
4	2	. 0	3	0	0	0 ;	
5	2	0	13	8	0	62	
7	0	0	7	4	0	57	
8	5	2	2	1	40	50	
9	2	0	8	.3	0	38	
10	9	2	4	1	22	25	
Total	39	16	45	24	41	53	
B. LON	GITUDINAL	CRACKING	3				
1	11	8	3	2	72	67	
2	8	5	4	3	63	75	
3	0	0	1	0	0	0	
4	2	0	3	0	0	0	
5	2	0	13	7	0	54	
7	0	0	7	4	0	57	
8	5	1	2	1	20	50	
9 .	2	0	8	3	0	38	
10	9	2	4	1.	22	25	
Total	39	16	45	21	41	47	

<sup>\*</sup>No data from Regions 6 and 11.

Table 5. Transverse crack density by NYSDOT region.

	Total Decks	Densit	y, cm/ı	n²
Region*	Inspected	Avg	Max	Min
1	14	6.9	26.8	0.6
2	12	5.5	12.7	0.5
3	1	· _	_	
4	5	_	_	`
5	15	5.0	12.1	0.9
7	7	8.4	8.6	8.2
8	7	11.1	11.1	11.1
9	10	1.2	2.4	0.2
10	13	10.6	21.0	0.4
Total	84	6.9	26.8	0.0

<sup>\*</sup>No data from Regions 6 and 11.

Table 6. Transverse crack width by NYSDOT region.

Width, mm					
Region*	Avg	Max	Min		
1	2.2	6.4	1.0		
2	2.3	6.4	0.5		
3	, · · · -	-	<del>-</del> .		
4	· _	-	_		
5	1.5	6.4	1.0		
7	1.0	1.0	1.0		
8	1.0	1.0	1.0		
9	1.0	1.0	1.0		
10	1.4	1.6	1.0		
Total	1.5	6.4	0.5		
	_				

<sup>\*</sup>No data from Regions 6 and 11.

Table 7. Class HP deck performance compared with Class E and H decks\*.


	Transverse Cracking			<b>Longitudinal Cracking</b>		
	Total	Avg	Total	Total	Avg	Total
Cracking Amount	Cracks	Width	Length	Cracks	Width	Length
Significantly less	22.5%	20.0%	22.5%	6.0%	9.7%	6.5%
Less than before	22.5%	10.0%	22.5%	39.0%	35.5%	38.7%
About the same	35.0%	57.5%	45.0%	42.0%	54.8%	51.6%
More than before	20.0%	10.0%	10.0%	9.0%	0.0%	0.0%
Significantly more	0.0%	2.5%	0.0%	3.0%	0.0%	3.2%
				0 /0	<u> </u>	

<sup>\*</sup>Table omits decks with no cracking

Table 8. Initiation of cracking.

	Total	% of
Cracking Began	Responses	Responses
During curing	0	0
0-7 days after pour	4	11
0-14 days after pour	16	44
14-28 days after pour	6	17
More than 28 days	9	25
More than 6 months	_ 1	3

Figure 2. Initiation of cracking.

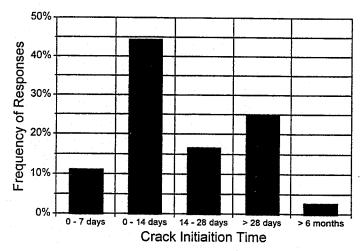

in New York State. In that report, crack densities were recorded for 13 AASHTO decks built between 1982 and 1988. Maximum crack density was 27.3 cm/m². Special Report 117 (6) examined effectiveness of a new curing procedure issued in EI 86-24 (7). A very controlled crack survey was conducted, in which randomly selected decks were sectioned into grids and inspected for cracking. Stress-related cracking was ignored, but transverse, longitudinal, and diagonal cracks were included. The decks were often sprayed with water to enhance visibility of cracking. The maximum crack density reported was 655 cm/m².

- 5 Crack widths are detailed in Table 6, where average, maximum, and minimum measurements are 1.5, 6.4, and 0.5 mm, respectively. Many regions reported crack widths of "< 1mm", which were listed as 1 mm, and results in Table 6 thus are probably conservative. It should also be noted that widths were not measured at crack roots but rather at crack tips, which may be worn from traffic.
- 6. Inspectors were asked to compare Class HP decks to Class E and H decks. Thirty-two of 40 responses (80 percent) reported that Class HP concrete decks performed about the same or better than Class E or H decks in transverse cracking. Twenty-nine out of 33 responses (88 percent) stated that Class HP concrete decks performed as well or better than Class E and H concrete decks in resisting longitudinal cracking. These numbers correspond to the italicized values in Table 7, which lists percentages of responses that compared cracking on HP decks to Class E and H decks. A breakdown of actual numbers by region is given in Appendix B.
- 7. Time to first appearance of cracking was also surveyed -- most deck cracks appeared within two weeks after the concrete pour, as shown in Table 8 and Figure 2.

·
$t = -\epsilon$
·
·

# **III. CONCLUSIONS AND RECOMMENDATIONS**

Results of this survey indicate that since publication of Engineering Instruction 96-024 and introduction of Class HP concrete for New York State bridge decks, performance of deck material has improved. "Performance" is measured here in terms of increased crack resistance without compromise in workability, construction practices, or both. Class HP deck performance was compared to Class E and H decks. (Construction practices for Class HP decks were relatively unchanged from those for Class E and H decks.)

Quantitative data were obtained for transverse cracking, but only qualitative information for longitudinal cracking. Nearly half the bridges inspected had no cracking at all. Of Class HP decks inspected, 80 percent were reported to perform as well as or better than Class E and H decks. Within the service period covered, no correlation appeared between deck year-in-service and either crack density or amount of cracking. Crack densities have been comparable to those reported in the recent literature for other concrete decks. Most cracks occurred within two weeks of the deck pour, and were not influenced by staged construction.

				•
				•
		•	×.	
		,		
		•		
	·			
e de la composition della comp				
				•
				1

# **ACKNOWLEDGMENTS**

Several Department of Transportation personnel contributed to the success of this study. Special thanks are extended to Dr. R.J. Perry, Director of Transportation Research and Development, the Structural Support Services Unit, the Bridge Inventory and Inspection Unit of the Structures Design and Construction Division, and Regional Construction Groups who inspected the bridge decks.

			1
	•		
•			
			•
		•	
•			
			•
			•
			-
			**************************************

#### REFERENCES

- 1. Standard Specifications Construction and Materials. New York State Department of Transportation, 1995.
- 2. Streeter, D. A. "Developing High-Performance Concrete Mix for New York State Bridges." Transportation Research Record 1532, Transportation Research Board, 1996, pp. 60-65.
- 3. Perry, R. J. "Sealers and HP Concrete." Internal memorandum to W. J. Brule, Materials Bureau, dated February 1, 1996
- 4. "Implementation of Class HP Concrete." Engineering Instruction 96-024, New York State Department of Transportation, April 12, 1996.
- 5. Fu, G., Alampalli, S., and Pezze, F.P., III. Lightly Reinforced Concrete Bridge-Deck Slabs on Steel Stringers: A Summary of Field Experience. Research Report 161, Transportation Research and Development Bureau, New York State Department of Transportation, June 1994.
- 6. Lorini, R.A., and Hossain, M.M. Effects of Curing on Bridge-Deck Concrete Shrinkage Cracking. Special Report 117, Transportation Research and Development Bureau, New York State Department of Transportation, March 1995.
- 7. "Structural Slab Concrete and Overlay Curing Procedures." Engineering Instruction 86-24, New York State Department of Transportation, May 23, 1986.

						*
	•					
1 × 1						
						•
		•				•
						•
					•	
			•			
		,				
				•		
				•		
						·
						4 4

# **APPENDICES**

- A. SURVEY QUESTIONNAIRE ON HP CONCRETE-DECK PERFORMANCE
- **B. SURVEY RESPONSES FROM NYSDOT REGIONS**
- C. REGIONAL COMMENTS ON HP CONCRETE PERFORMANCE

						·
			i			
•						
					-	
						•
						-

#### APPENDIX A. SURVEY QUESTIONNAIRE ON HP CONCRETE-DECK PERFORMANCE

This questionnaire concerns performance of bridge decks using HP concrete. As you are aware, current Department standards call for HP concrete for bridge decks, introduced to increase durability by reducing cracking and permeability. Several complaints have been received concerning HP concrete decks cracking. But, quantitative information is lacking in this regard to evaluate the true performance of HP concrete decks. At present, the Bridge Performance Committee, the Concrete Committee, Structures Construction and Design Division, and Technical Services Division are all examining this issue and we are conducting this survey on behalf of them. Thus, we ask you to provide the following information for **each bridge deck** built in your region using HP concrete. After receiving the survey responses, we will send you a copy of the summary. For further explanation, contact Sreenivas Alampalli or Frank Owens of Transportation Research & Development Bureau at (518) 457-5826.

#### **DECK INFORMATION**

BIN	PIN	Contract No.	Region	County
Q1. Month	and year of deck p	lacement:		
	nis a continuous por and year opened to			
Q2. Are the	ere any cracks on the	ne deck? If, possible p	lease provide photo	ographs.
If no cr	acks, go to question	n 10 directly.		
		ovide the following de	tails with a map of	the cracking:
<ol> <li>Total num</li> <li>Total leng</li> </ol>	nber of transverse o	***************************************		

Q3. Based on your experience, how do you compare this deck cracking to decks built with concrete used by the Department before HP concrete was introduced (choose one of the following).

	LONGITUDII	NAL. CRACKS		TRANSVERSE	CRACKS	
	Number of Cracks	Average Crack Width	Total Crack Length	Number of Çracks	Average Crack Width	Total crack Length
Significantly less than before						
Less than before				8		
About the same						
More than before						
Significantly more than before						

Q4. Have you any information as to w	hen cracking began?
1. Within 24 hours of deck pour	
2. Within 48 hours of deck pour	
3. Within 7 days of deck pour	
4. Within 14 days of deck pour	
5. After 28 days	
6. As soon the deck was opened for th	e traffic ( days after last deck pour).
7. During Stage II construction (if app	
8. Other	
Q5. If staged construction was used, ir	your opinion how did this affect deck cracking?
Q6. Please provide any other comments concrete in decks (also include EIC or i	s on construction issues you may have, relating to use of HP inspector comments, if available).
Q7. Your contact information:	
Name:	Telephone No:
Title:	Fax No:
Region:	e-mail (if available):
Work Location:	

Mail the completed questionnaire to the following address. Sreenivas Alampalli
Transportation R&D Bureau
New York State Department of Transportation
Albany, NY 12232-0869
Tel/Fax: (518) 457-5826/7535

e-mail: salampalli@gw.dot.state.ny.us

Address:

# APPENDIX B. SURVEY RESPONSES FROM NYSDOT REGIONS


DNR = Did not report

NOTE 1		NOTE 2		Γ
Comparis	Comparison between Class HP and E	Cracks	Cracks were first noticed	
Class HP	Class HP Exhibits Transverse/Longitudinal Cracking.			
		1 M	Within 24 hours of deck nour	
-	Significantly les	2 W	Within 48 hours of deck nour	
2	Fess	3 W	Within 7 days of deck pour	
က	About the same	4 Wit	Within 14 days of deck pour	
4	More	5 After	Affer 28 days	
5	Significantly more	9	Jpon deck openina	
		7 Dur	During stage II	
		8 Other	Je Je	

17.5550   1	MIG	NIG	REG	STG CRK	1	TRAN LONG		STG	STG	AGE	TRAN	TRANSVERSE		ONG	LONGITUDINAL		TRAN	TRANSVERSE	ш	CRK		CRK
175256		T	)	-	i			TVS	_		NOM	ENGTH \	_	NOM N	/IDTH L		MOM	ENGTH	WIDTH	STRT	-71	DENS
175246   1								CRK	CRK			(m)		VOTE 1			NOTE	1		NOTE 2	-T	(cm / m <sup>2</sup> )
1752545   1	חסקקקק		-	>	z									_								
1722-20   1	D222220	175355	-	>	z	-																
172164(1)   1   1   1   1   1   1   1   1   1	100422	175297	-	Z	   	>	>	z	z	8	11		Hairline	2	2	7	3	2	3	4	6899	4.933473
1753-24   1	100722	402708	-	2	>	>	z	z	z	86	5				DNR	DNR	ည	3	က	9	1096.2	1.824485
1721-1721-1721-1721-1721-1721-1721-1721	1033300	475909		: >	. >	>	>	>	>	86	6	_	Hairline	က	က	3	3	က	6	4	102.1	26.83643
177519400 1 7 Y N Y Y Y Y Y Y 97 5 DNR Haiffine 3 3 3 3 3 3 5 5 5 5 7 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	2202240	173563		<del> </del> - >	- >	- >	· >	<b> </b> >	<b>&gt;</b>	$\overline{}$		<del>                                     </del>	Hairline	2	2	2	4	ဗ	4	9		¥
17531901	0.23/223	470404(1)	-	- >	- 2					Γ												
17531990		1/2104(11)	+	- :	2 >	,	>	>	>	20	u		Hairline	6	6	3	3	က	က	2		
1763490	D257302	175319(1)	-	- ;	> ;	- ;	- >	- >	- >	6	, 5	1-	Hairtine	0 60	6	8	60	3	3	5		
190485(l)		175319(II)	-	<b>&gt;</b>	-	- :	- ;	-  =	- >	+-	2 2	1	+	200	racks or	N Aro	DNR	DNR	DNR	ı,	8905.7	
160485(M) 1 Y Y Y N Y N Y N Y N Y S M N Y S M N Y S M N Y S M N Y S M N Y S M N Y S M N Y S M N Y N N Y S M N Y N N Y N N Y N N S M S M N S M N S M N S M N S M N S M N S M N S M N N N N	1062850	180485(1)	-	>	>	z	<b>&gt;</b>	2	- :	+			$\top$	Solida Solida	Diore .	00114	a de	aNC	SNR	67	3887.7	
180496    1	1074940	180485(IA)	-	>	>	z	>	z	>	96	NY.	YN !	-	Joints	bicis.	Could II		ONG.		ď	3887 7	
103414(1)	1074940	180485(II)	-	>	>	z	>	z	>	96	DNR	DNR	$\top$	Comap	are. (La	OX OT EX	באר האל	מאַן	5	2	44274	0 536452
103414(i)	D256471	103414(1)	1	<b>,</b>	Υ	>	>	<b>&gt;</b>	>	96	2	6.1	6.4	7	2	2	7	7	7	בו ה	1.07.1	0.000404
204223         2         N         Y <td>1002579</td> <td>103414(II)</td> <td>-</td> <td>z</td> <td>&gt;</td> <td><b>-</b></td> <td>&gt;</td> <td>z</td> <td>z</td> <td>96</td> <td>3</td> <td>6.1</td> <td>4.8</td> <td>7</td> <td>2</td> <td>2</td> <td>2</td> <td>7</td> <td>7</td> <td>2</td> <td>113/.1</td> <td>0.550452</td>	1002579	103414(II)	-	z	>	<b>-</b>	>	z	z	96	3	6.1	4.8	7	2	2	2	7	7	2	113/.1	0.550452
204223 2 N Y Y Y Y Y N N 95 13 110 0.5 3 3 2 2 2 3 8 8 2 2 2 2 3 8 8 2 2 2 2 3 8 8 2 2 2 2	TOTAL		14	£	1	80	10	20	<b></b>													6.9
204223   2	1017																					
204223   2   Y   Y   Y   Y   Y   Y   Y   Y   Y	1018961	204223	٠	2	<b>\</b>	٨	Υ	Z	Z	26	6	64	Hairline	က	3	3	2	2	8	80	1093.7	5.851696
2016723 2 N Y Y Y Y Y Y Y Y Y Y Y Y Y Y Y Y Y Y	1010001	204223	,	>	>	>	>	>	>	96	13	110	0.5	3	3	3	7	7	3	80	1093.7	10.0576
2018721 2	1010002	204223	4 0	- 2	>	>	>	z	z	96	7	16.8	0.5	3	3	3	2	2	က	8	2113.5	0.79489
2018172(1)   2	4010072	204223	,	: >	>	>	>	>	>	97	3	18.3	Hairline	3	3	3	2	2	3	8	2033.2	0.900059
2016/24(1)   2   N   Y   Y   Y   Y   N   N   N   97   12   8.5   6.4   3   3   3   3   3   3   3   3   10 NR   2016/24(1)   2   N   Y   Y   Y   Y   Y   Y   Y   Y   Y	4010071	204022(1)	,	- >	- >	>	>	>	<b>&gt;</b>	97	12	8.5	6.4	က	3	3	3	3	တ	DNR	196.7	4.321301
2018656   2	1020130	201012/11	,	- 2	. >	>	>	z	z	97	12	8.5	6.4	က	3	3	3	3	9	DNR	196.7	4.321301
205661         2         Y <td>1020130</td> <td>2010/2(11)</td> <td>,</td> <td>2 2</td> <td>- &gt;</td> <td>- &gt;</td> <td>z</td> <td>z</td> <td>z</td> <td>97</td> <td>23</td> <td>478.4</td> <td></td> <td>DNR</td> <td>DNR</td> <td>DNR</td> <td>4</td> <td>4</td> <td>ις.</td> <td>4</td> <td>3781.8</td> <td>12.65006</td>	1020130	2010/2(11)	,	2 2	- >	- >	z	z	z	97	23	478.4		DNR	DNR	DNR	4	4	ις.	4	3781.8	12.65006
2005668         2         Y </td <td>4024760</td> <td>20102</td> <td>,</td> <td>2 &gt;</td> <td>- &gt;</td> <td>&gt;</td> <td><b>-</b></td> <td>&gt;</td> <td>&gt;</td> <td>97</td> <td>12</td> <td>31.7</td> <td>Hairline</td> <td>2</td> <td>DNR</td> <td>DNR</td> <td>-</td> <td>3</td> <td>2</td> <td>80</td> <td>1222.2</td> <td>2.593684</td>	4024760	20102	,	2 >	- >	>	<b>-</b>	>	>	97	12	31.7	Hairline	2	DNR	DNR	-	3	2	80	1222.2	2.593684
201865   2	1004760	00007	,	. >	>	>	<b>/</b>	>	>	97	4	3.4	Hairline	က	3	3	2	2	2	æ	732.8	0.463974
201865 2 Y Y Y Y N Y N 96 32 107 3.2 DNR DNR 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4 4	1004/40	205661	2	- >	z	•																
201865(11)         2         Y         Y         N         Y         N         96         38         107         3.2         DNR         DNR         A         4	1053740	201865		>	<b>\</b>	<b>\</b>	z	>	z	96	32	107	3.2	DNR	DNR	DNR	4	4	4	4	1170.5	9.141393
375215 3 N N N N N N N N N N N N N N N N N N	1053740	201865(II)	2	>	7	<b>&gt;</b>	z	>	z	96	38	107	3.2	DNR	NA R	DNR	4	4	4	4	1170.5	9.141393
375215 3 N N N N N N N N N N N N N N N N N N	TOTAL		12	8	11	11	8	7	2													5.5
375215 3 N N N N N N N N N N N N N N N N N N														-								
A 4 4 4 4 8  S S > > X S  S Z Z Z Z Z O  S Z Z O  S Z Z O	4435080	375215	3	z	z																	
Z Z > > Z Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z O Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z O Z Z Z Z O Z Z Z Z Z O Z Z Z Z Z O Z Z Z Z Z Z O Z									ŀ													ALCOHOLD STATE OF
Z	D256505		4	z	z					1							ļ.,				-	
X X O X Z O X Z O X Z O X Z O O X Z O O O O	D256520		4	z	z				-	-												
X X X X X X X X X X X X X X X X X X X	D256544		4	>	z					+				];								
5 2 0 0 0 0 0 0 0	D256531		4	٨	z	z	z	z	z	1	Stress	s related c	racking or	<u> </u>			_					
5 2 0 0 0 0	D256405		4	z	z	z	z	z	z		Stress	s related c	racking of	<u> </u>								
	TOTAL		2	7	0	0	0	٥	0													

			+						Г	1	TOANCYCOCE	1001	-	ONC	IONGITIONAL		TRA	TRANSVERSE	,,	CRK	DECK	CRK
N 0	NIG	REG	SIG	SK K K	Z S	PION P	-			ACE	1	101	┿		T. L.	_	NI IN	HEUM HEDEL	MIDTH	STDT	AREA	SHAC
							2		<b>9</b>	Z	M LE	S E		NO.	NOM WIDTH LENGT	_	MON S	רבואפוע	MICHA	ALOTE	_	Cym / mo/
							SK	쭚	7	+	7	$\dashv$	ᆿ		+	T	NO IE			13	<u> </u>	7 11 / 1101
1030780	520929	5	z	<b>&gt;</b>	>	z	z		6 Z	95	9	76.8	6.4	DNR	DNR N	NR R	4	က	63	3	636	12.0/54/
1071441	500647	2	z	>	>	>	z		6 N	96	20 2	24.4	-	2	2	2	-	-	-	4	483.8	5.043406
1071451	500647	5	z	>	>	>	Z		6 N	96 M/	MAP	MAP	1	2	7	7	-	-	-	4	487.7	¥
1071471	500647	2	z	>	>	>	z		-	95	8	3.7	1	2	2	2	-	-	-	4	417.5	0.886228
1071481	5006472	5	z	>	>	>	z		-	95 M/	MAP	MAP	1	2	2	2	-	-	1	4	409.7	≨
1071501	500647	5	z	>	>	>	Z	_	о 2	95 MA	MANY 1 E	EACH	-	7	7	2	-	1	-	4	557.9	₹
3329270	575401	S	z	z			_															
1062550	530778	2	z	>	>	>	Z		6 2	95 2	23	44	-	3	3	3	6	3	3	DNR	326.5	4.287902
1046551	503311	5	z	z										1	1							
1046552	503311	2	z	z						_				1								
1027780		2	z	z						-				+	1							
1011659		2	z	z								1		1	1							
332829	575387	2	Υ	z						-		-		1	j							
3326930	575411	2	<b>\</b>	Z							$\dashv$		1	1								_
1044230	513119	2	z	<b>\</b>	<b>&gt;</b>	<b>\</b>	Z		o z	35	2	31.6	-	4	DNR	DNR	7	2	3	က	1141.5	2.76
TOTAL		15	7	8	8	7	0	-	0				*									2
			:	,	>	>	2		2	ארן אס	and	and	SNR.	ıc	2	5	r	က	8	2	156.7	ΨN
3340810	61260/	1	2 2	- >	- >	- >	2 2	-	+	+	ــــــــــــــــــــــــــــــــــــــ	╁	N N	-	8	-	7	က	9	တ	141.4	Ν
3337930	745253		2	- >	- >	<b> </b> >	Z	-	$\vdash$	$\top$	<u> </u>	<del>                                     </del>	Hariline	2	6	2	3	3	3	2	435.9	8.602891
1021340	704424	-	z	>	>	>	Z			97 (	9	6.1 H	Hariline	2	3	2	-	3	-	8	74.3	8.20996
3369170	775195	^	z	z																		
1032120	750062	7	z	z							-											
1044890	703002		z	z			-	1		-												;
TOTAL		7	0	4	4	4	0		0	-												8.4
								-									,		·	a de		
3222020	875504	8	>	z			-	+	+	+	<u>·</u>	$\dagger$	T			1	-  '	-	- 6	<u>ا ج</u>	000	44 40800
1022300	846043	8	>	>	>	z	>	+	Z	98	9	8	0.5	K K	DNR N	DNR	2	ED	6	2	808.2	11.13280
1044579	872938	8	<b>&gt;</b>	z				1				+	+	+							-	
1044659	872938	8	z	z			_	-		+	+	+			†							
3348160	875517	8	>	z			_			+		+			1							1
1005201	804085	8	<b>\</b>	>	>	>	>		<b>5</b>	$\neg$		十	Hariline	4	-	8	4	-	e	4	483	¥ :
1005202	804085	8	z	>	>	>	Z	_	+	98 Ms	Many	Short	Hariline	4	+	6	4	-	m	4	492.3	ž
TOTAL		7	2	3	3	2	2	_	-	_	_			7								

BIN	N.	REG	STG	CRK	TRAN	LONG	STG	STG	AGE	TRAN	TRANSVERSE		LONG	LONGITUDINAL	A	TRA	TRANSVERSE	ш	CRK	DECK	CRK
							TVS	LNG		NOM	LENGTH WIDTH	WIDTH	MOM	NUM WIDTH LENGT	LENGT	NOM	NUM LENGTH WIDTH STRT	WIDTH	STRT	AREA	DENS
							CRK	CRK			(m)	(mm)	NOTE 1	1		NOTE	1		NOTE 2	(m^2)	(cm / m^2)
1030710	916617	6	z	Z																	
1003820	930666	6	z	z																	-
1030530	921316	6	z	≻	Υ	Υ	z	z	97	MANY	10.1	Hairline	7	2	2	4	4	4	5	1168.9	0.86406
1003711	935755	6	z	z																	
1030720	916617	9	z	z																	
1021360	912504	6	Z	٨	Y	Υ	z	Z	96	2	17	1	-	-	-	-	-	1	DNR	721.2	2.357182
1021390	912504	6	٠	z																	
1045660	975170	6	z	z																	
1026390	912026	6	z	Υ	λ	Y	z	Z	96	3	1.8	Hairline	က	3	3	က	3	3	DNR	743	0.242261
1017540	912026	6	٨	z									က	3	3	3	3	3	DNR	332.2	NA
TOTAL		10	2	3	3	3	0	0													1.2
											:										
1019439	5886(I)	10	۲	z									-								
1019439	5886(II)	10	Υ	>	>	>	<b>&gt;</b>	>	86	Ξ	13.9	Hairline	က	က	3	က	က	က	5	3112.2	0.446629
1019439	5886(III)	10	>	z																	
1019439	5886(IV)	10	z	z							-										
1049491	22860	10	>	z				-									-	22			
1049441	22860	10	>	z										•							
1049461	22860	10	>	z																	
1049471	22860	10	>	z													-				
1056779	5289264	10	<b>&gt;</b>	z											-					-	
1073260	18801	10	>	>	۲	٨	>	>	97	4	187	1.6	EIC's s	tate that	EIC's state that they lack the experience in bridg	k the e	xperience	in bridg	8	1806	10.35437
1073250	18801	10	z	>	>	>	z	z	97	113	633	1.6	necess	ary to m	necessary to make this comparison.	compa	rison.		80	3008.4	21.04108
1073282	18801	10	z	z													2				
1073281	18801	10	z	z																	
TOTAL		13	9	3	3	3	2	2													10.6
					11 1														_	=======	
TOTALS		84	39	43	40	37	16	16						53	-		32				6.9



#### APPENDIX C. REGIONAL COMMENTS ON HP CONCRETE PERFORMANCE

## Workability

- If the slump requirement was less strict, it might be easier to finish.
- Spalling and flaking were problems on a number of decks.
- Slump was very critical to the quality of the finish.
- Class HP was more difficult to seal than Class H.
- Finish of the deck was "terrible" and prompted investigation into other decks.
- Sealing was easier when water was added at the site. (Max slump of 4.5")
- Finish was excellent.
- Was finished easier with a broom than with astro-turf.
- When contractor tried to apply astro turf finish, the concrete started to tear or pull apart.

#### **Cracking**

- Cracking slowly increased while crews were working at the site.
- HP pours of substructure elements exhibited cracking. These pours were of significant volume. The deck did not exhibit problematic cracking.
- Cracks seem to generate over floor beams of truss superstructures.
- Vibrations from traffic on Stage 1 decks causes Stage 2 decks to crack.

#### Material

- Material is very sensitive to the environment, particularly sun, wind, and heat.
- Concrete needs extra time to set up.

#### Construction

- Pour went very slowly
- Make closure pours mandatory in staged projects.
- There should be some investigation of the benefits of saw cutting a control joint over piers or places of zero deflection.
- The contract should specify a quantity of time and labor to smooth the approach pavement for phase 2 detours to reduce vibration from 18-wheel loads.

#### Live Load

- Much less superstructure deflection after closure pour.
- HP produces a very hard, stiff deck. Bracing needed to hold the deck forms is more than the EIC is used to. The steel may be too flexible for the deck.
- Girders were observed to deflect excessively under live load.
- Girders vibrate during deck pour.

#### **Summary of EIC Comments by Contract Number**

#### D257460

Staged construction was used in this project. Longitudinal and transverse cracks were about the same or less than with Class H concrete. There was less vibration in the bridge deck once the closure pour was complete. There should be investigation of placing a control joint over piers or locations of zero deflection.

#### D256757

HP concrete produces a very hard, stiff deck. Structural steel may be too flexible for the bridge deck's increased stiffness. No data were given for this deck as to whether is was more resistant to cracking than previous decks.

#### D257081, D257087 & D257236

HP concrete was more difficult to finish. Cracking in these decks was about the same or less than Class H decks. At D257081 bad finish of the bridge deck prompted investigation into other decks, but further information was not available. D257236 was reported to have excessive scaling and flaking with some difficulty finishing. Most cracks were observed in the tension zone.

#### D257234

Transverse cracks appeared directly over each floor beam of the truss system. These cracks did not appear to be any worse than those observed with Class H concrete. Staged construction did not negatively affect cracking. Cracking could have been caused by traffic vibration during concrete curing. The HP deck had an excellent finish.

Cracks that were worse or significantly worse using HP

#### D257229

Cracks in this deck were reported to be greater in number and length than on Class H decks. Staged construction was used. Girder vibration was observed during deck pour. Once live load was allowed on the new deck, girders appeared to experience "excessive deflection". HP concrete needs more time to set up. The other main concern was that bridge girders apparently not stiff enough.

#### D257236

Longitudinal and transverse cracks were more numerous than before. The number and length seemed to be growing over time. This was a continuous pour. Two parts of the project (EB & WB) were done a month apart. The only live load on or near the bridge was during contractor operations.

#### D256581

In this deck, number and total length of longitudinal cracks were significantly greater than before. The deck was continuously poured. The bridge is a single-span prestressed-concrete voided-slab bridge. This deck was one of the first using HP concrete. There were no problems with the deck finish.

#### D256448

This bridge deck was a non-continuous pour, and had more longitudinal cracks than with previous standard mixes. Staged construction was not believed to affect cracking. Cracks followed through Stages 1 and 2 over piers.

#### D256070

This bridge had a continuously poured HP deck, steel plate-girder superstructure, and integral abutments. Staged construction was not used. The cracking is isolated to the control joint area and ends of the slab. The transverse number, width, and length are all worse than Class H decks. There were large deflections (6") of girders at midspan. Cracking appeared to be due to superstructure rotation/movement of the integral design. HP requires less hand finishing but more mixing time for a consistent mix.

						F
						·•
						*
				•		
						0
						į
						>
		• .				
						3
						-
	2					
			A contract of			